

High Power Three-phase Fully Automatic Test System with Reference Standard and Integrated 3-phase Current and Voltage Source

Calmet TS41

- Easy verification of meters under precise load conditions, using integrated current and voltage source
- Automatic operation with predefined load points without need of an external PC
- High output power per channel: up to 300VA for current and up to 150VA for voltage
- Modern SD flash memory card up to 32GB for storage of customer data and measurement results
- Display of vector diagram, phase sequence, wave form oscilloscope, harmonics spectrum bar and trend charts for analysis of the mains conditions
- User-friendly system for data input and operation of combined source and reference meter
- The system may be used either as a stand-alone reference standard meter class 0.04 or 0.1, or together with the integrated power source, or power source with reference meter for new or modernized test bench station
- Data readout and test system control via USB & Ethernet
- 4-wire voltage output and sense connection




Front view

Calmet TS41 automatic test system consists of a three-phase reference meter of accuracy class 0.04% (or 0.1%) and integrated high power three-phase current and voltage source up to 3x120A/600V. The TS41 is designed for testing energy meters in meter test station eg TB41.

Calmet TS41 Automatic Test System is used for:

testing electricity meters according to EN 50470, IEC 62052, IEC 62053 and ANSI C12 in laboratory including measure of meter error, register error, start up current, no load (creepage) test, repeatability and influence of different quantities,




- powering test bench station up to 4 meter positions including isolation transformers ICT,
- metering power network parameters due built in high accuracy reference standard.



Rear view


Examples of application

The use of TS41 as a stand-alone reference meter for electricity meter testing

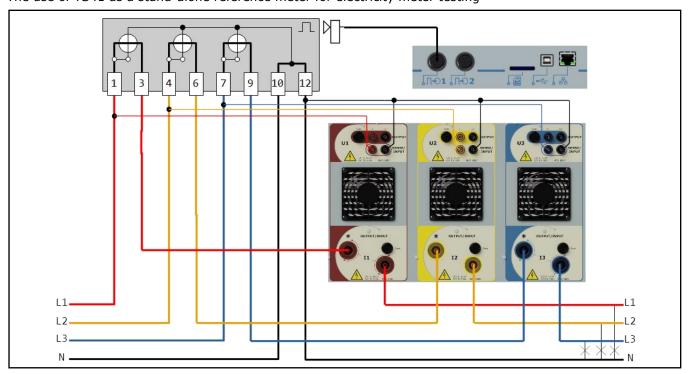




The use of TS41 as 3-phase source with built in reference meter for electricity meter testing

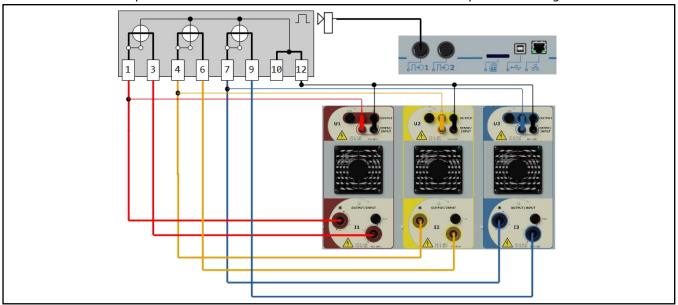

The use of TS41 as 3-phase source with built in reference meter for electricity meter 4-positions test bench station

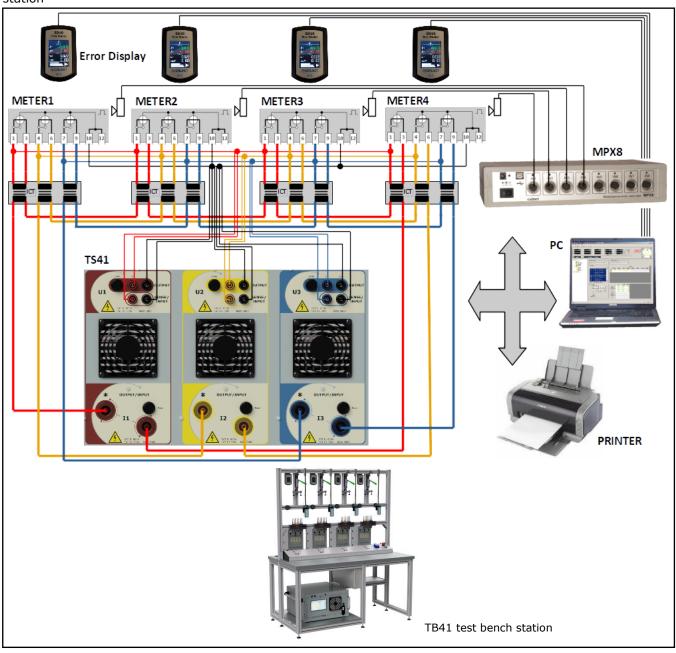



The TS41 as a reference meter and power network parameters analyser

Color Touchscreen for easy operation enables:



measurement of power network parameters: voltages U1, U2, U3, U12, U23, U13, UN, currents I1, I2, I3, IN, frequency f, phase angles φ1, φ2, φ3, power factors PF1, PF2, PF3, ΣPF, factors sinφ1, sinφ2, sinφ3, Σsinφ, tgφ1, tgφ2, tgφ3, Σtgφ, angles between voltages ∠U12, ∠U13, powers P, P+, P-, PH1, PH1+, PH1-, Q, Q+, Q-, QH1, QH1+, QH1-, S, S+, S-, SH1, SH1+, SH1,
visualization of measurement results in form of: table,

trend chart, oscilloscope (waveform) or bar chart (harmonics of U, I, P, Q).

Parameter	B	Accuracy 1)2)3)4)		
	Range	class 0.04	class 0.1	
Voltage	0.05600V	±0.04% ⁵⁾	±0.1% ⁵⁾	
Current	0.01120A	±0.04%	±0.1%	
Current	0.001 <u>0.01A</u>	±0.04%*	±0.1%*	
Dower and energy	0.01120A / 10600V	±0.04%	±0.1%	
Power and energy	0.001 <u>0.01A</u> / 10600V	±0.04%*	±0.1%*	
Frequency	4070Hz	±0.01Hz		
Phase shift	Phase shift -180+180°		±0.04° 5)6	
Power factor cosφ and sinφ	±0.001 ⁵⁾⁶⁾			
Temperature coefficient	0.001% per 1°C in range -10+50°C			
Time stability	Short term [1h] = 0.01%, long term [1 year] = 0.03%			
Power short term [1h] stability	±0.010%	±0.020%		
Power long term [1 year] stability		±0.025%	±0.050%	
Power temperature coefficient per 1°C		±0.002%	±0.005%	

vectors,

⁶⁾ in current range 0.01...120A

Specifications for the power quality parameters					
Parameter		Range		Accuracy 1)	
Harmonics in voltages,	amplitude	0100% of input	1 st 63 rd	±0.1% ²⁾	
currents, P and Q powers	phase	-180+180°	1563.5	±0.5° ³⁾	
Total harmonic distortion THD in voltages and currents		0100% of input	1 st 63 rd	±0.1% ²⁾	
Total interharmonic distortion TID in voltages and currents		015% of input	403200Hz	±0.2% ⁴⁾	


¹⁾ absolute extended uncertainty under confidence level of 95% covers reference uncertainty of standards, stability in 12 months, influence quantities (ambient temperature +20...+26°C, humidity and power supply voltage 85...265V, frequency 47...63Hz)

The TS41 as a power calibrator - current and voltage source

TS41 power calibrator can work as voltage and current source with programmable phase shift between current and voltage and between voltages.

TS41 power calibrator operates in symmetric and asymmetric circuit of connection and enables setting of:

- voltages U1, U2, U3, U12, U32, U13,
- currents I1, I2, I3,
- frequency f
- phase angles φ1, φ2, φ3,
- power factors PF1, PF2, PF3,
- factors sinφ1, sinφ2, sinφ3,
- angles between voltages ∠U12, ∠U13
- maximum allowed values of voltages and currents,
- wave shape of output signals with using harmonics and predefined shape functions.

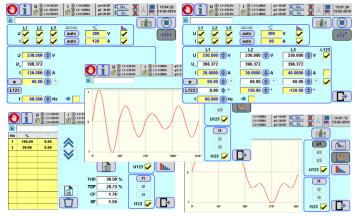

^{1) % -} related to the measuring value, %* - related to the measuring range final value (is underlined)

²⁾ absolute extended uncertainty under confidence level of 95% covers reference uncertainty of standards, stability in 12 months, influence quantities (ambient temperature +20...+26°C, humidity and power supply voltage 85...265V, frequency 47...63Hz)

⁴⁾ power and energy errors related to apparent power

⁵⁾ in voltage range 10...600V

 $^{^{2)}}$ of input for 80-140Hz frequency range of harmonics with linear rise to 0.4% of input for 3200Hz

³⁾ for 80-140Hz frequency range of harmonics with linear rise to 8° for 3200Hz

⁴⁾ of input for 80-140Hz frequency range of interharmonics with linear rise to 5% of input for 3200Hz



Specification for the sinusoidal signals					
Parameter	Range	Settings span	Resolution	Accuracy 1)2)	Maximum load
Voltage U	150V	20150V	0.001V		1A@150V
	300V	150300V	0.01V	±0.1%	500mA@300V
	600V	300600V	0.01V		250mA@600V
Voltage short term [10min] stability				±0.01%	
Voltage short term	[1h] stability			±0.03%	
Voltage distortion fa	actor			< 0.5%	
Current I	0.12A	0.020.12A 0.001 <u>0.02</u>	0.00001A	±0.1% ±0.1%*	5V@0.12A
	1A	0.12A1A	0.00001A		30V@1A
	12A	112A	0.0001A	±0.1%	14V@12A
	120A	12120A	0.001A	±0.1%	3V@60A 2.5V@120A
Current short term	[10min] stability			±0.01%	
Current short term [1h] stability			±0.03%		
Current distortion factor			< 0.5% 3)		
Frequency f		4565Hz	0.001Hz	±0.005Hz	
Phase shift φ		-180+180°	0.001°	±0.10°	
Phase shift short term [10min] stability				±0.05°	

absolute extended uncertainty under confidence level of 95% covers reference uncertainty of standards, stability in 12 months, influence quantities (ambient temperature +20...+26°C, humidity and power supply voltage 85...265V, frequency 47...63Hz)

³⁾ in current range 0.02...120A

Specification for the non-sinusoidal signals				
Parameter		Settings span	Resolution	Conditions
Harmonics amplitude phase		050% output value 1)	0.1%	to 40th or 2000H-
		-180+180°	0.1°	up to 40 th or 2000Hz
1) 50% of output value for frequency range of harmonics to 500Hz with linear decrease to 10% of output value for 2000Hz				

The TS41 as a tester of electricity meters

Testing of electricity meters (EM) may be realized in different situations:

- voltage and current circuits of the EM are powered from power net in this case the TS41 is used as a reference meter in manual operation mode or controlled via PC software,
- voltage and current circuits of the EM are powered from the TS41 in this case the TS41 is used as a test system with reference meter and integrated voltage and current source in manual or automatic operation mode with predefined (voltage and current) load points,

with using following functions:

- calculating meter error (partial errors, average error, standard deviation) directly in [%] with method of settings time of measurement or number of pulses,
- measuring energy for verification of meter counters directly in [%],
- maximum power measuring for testing of maximum power meters,
- for different kind of measuring powers P, P+, P-, PH1, PH1+, PH1-, Q, Q+, Q-, QH1, QH1+, QH1-, S, S+, S-, SH1, SH1+, SH1, as well as for the first harmonic of these powers,
- with visualization in form of table or trend chart.

In manual operation mode additionally may be used innovation functions:

- automatic identification of meter constant,
- automatic determining time of measurement or number of pulses.


In automatic operation mode accuracy may be referenced to an internal reference of the TS41 or to an external reference meter.












Specifications for impulse input/output					
Parameter	Voltage range	Frequency range	Uncertainty		
Impulse Input for counting pulses (two inputs)	02V/430V	0.0001Hz210kHz	0.001%@t≥1s		
Impulse Output for Calmet TS41 testing	28V/100mA open collector	0.0001Hz210kHz			

^{% -} related to the setting value, %* - related to the setting span final value (is underlined)



Automatic Testing of electricity meters in full range of loads is made by means of:

- Meter Type data base definition which consists of nominal voltage, base current, maximum current, meter constant and accuracy class, CT / PT transformers ratio
- Procedure data base definition which contains set of load point settings: voltage, current, power factor, frequency, symmetry, harmonics according to the standards requirements.
- AutoTest test execution for selected Meter Type according to selected Procedure with results in form of table and diagram with possibility to be stored in memory or transferred to PC and Excel sheet,

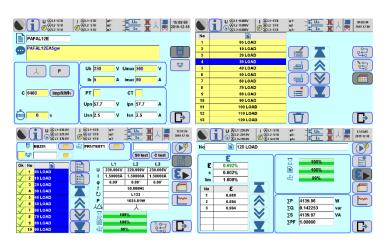


The TS41 - data management, PC Software, general parameters and equipment


Data Management. The operator can store all measurements and test results on a modern SD memory card up to 32GB, for recall and later visualization in LCD.

The data management software TS41 PC Soft provides the ability to transfer the data between TS41 and an external PC. All results can be summarized and printed in a test report by putting the SD card into an external PC or downloaded through USB or Ethernet.

The TS41 PC Soft software additionally provides the ability to manage data on an external PC or tablet:

- downloading of measurement results from the TS41 to a PC through communication port USB or Ethernet,
- · archiving of measurement results,
- printing of measurement results in a test reports,
- export of measurement results to Excel (directly to the XLSX file) and to the Windows clipboard.
- testing devices and performing measurements directly from a PC or tablet,
- sending files and test procedures from the TS41 to a PC and from a PC to the TS41,
- simultaneous testing of a device and performing additional activities in separate program windows:
 - ✓ measurement of network parameters,
 - √ registration of trends for all measured network parameters,
 - ✓ measurements of harmonics and histograms (bar chart),
 - \checkmark observation of oscilloscopes (waveform) and vector diagram,
 - ✓ creating and modifying automatic meter testing procedures.

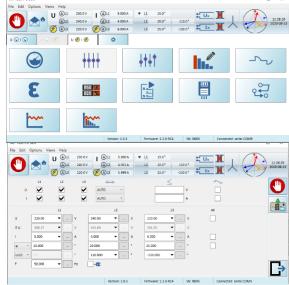





General parameters	
Weight	60kg
Dimensions with handles: width x height x depth	with handles: 272x560x485mm
Dimensions without handles: width x height x depth	without handles Rack 19" 6U: 272x482x455
Power supply	85265V / 4763Hz / 1800VA
Safety: Isolation protection and Measurement Category	IEC 61010-1 and 300V CAT III
Degree of protection	IP-20
Operation / storage temperature	-10+40°C / -20+60°C
Operation / storage relative humidity	<90% @ +0+30°C and <75% @ +30+50°C / <95% @ 0+50°C



Calmet TS41 Test System's equipment *)


All completed Calmet TS41 Test System's set consists of:

- Calmet TS41 test system class 0.04 or 0.1,
- power cord,
- fuse: 3xFF2.5A/600V, 3xFF16A/500V, 1xT12.5A/500V (2pcs),
 memory card SD 8GB,
- EA36 set of safety measurement cables (12pcs),
- EA25 set of shunts OUTPUT / SENSE (6pcs)
- C091A T3475-001 plug Amphenol for Reference pulse output,
- operation manual,
- warranty card,
- manufacturer calibration certificate.

- manaracturer cambration certificate:					
Optionally for Calmet TS41 Test System are available:					
Calmet TS41 PC Soft with operation manual and USB B / USB A interface cable,	0 + 0 k - c c m c c m c c m c c	MPX8 – 8 channel error calculator with control software,	The state of the s		
AKD300 120A test leads (6pcs) with terminals set (18pcs),	8888 H	ED10 – individual error display with USB output	100 mg/s		
EA20 additional accessories for safety cables,		ER30.3 3-position rack for hanging of meter with quick connection device 3-phase,			
 CF106H photo head with holder for inductive meter and meter with LED, 		 EA27.3, EA27.4 – set of cables for 3/4 postions test bench station with isolators ICT: 24/28 voltage cables 3 current cables 120A – long 9/12 current cables ICT 120A 			
EA26 additional accessories for safety cables 12x banana plugs,12x fork plugs,	55	EC10.3 – 3 phase current isolation transformer ICT,	22101 KUA		
ER10H.3 1-position rack for hanging of meter with quick connection device 3-phase,		ET32 transportation case for additional accessories.			

*) All pictures are for demonstration only and can be changed without notice

Example modernization set for old Test Bench Station to modern 4-positions station

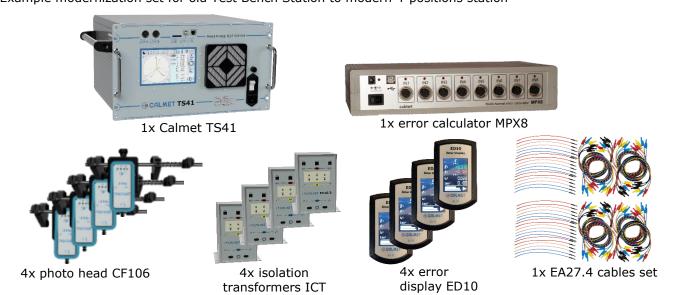

Calmet sp. z o.o.

Kukulcza 18, 65-472 Zielona Gora, Poland Phone +48 68 324 04 56 Fax +48 68 324 04 57

E-mail: mail@calmet.com.pl Web: http://www.calmet.com.pl